

# Temp. & RH% Datalogger

LCD display



8808


LED display



8809

## Large Display Temp. + RH% Datalogger

- ▲ Wall mountable super large display for easy reading and save space
- ▲ Air temp., dew point temp.& RH% display
- ▲ Tripod mountable receptacle for long time use
- ▲ Detachable standers to transform as desktop
- ▲ Recording temp. & humidity for quality control
- ▲ Button and PC programing are both available
- ▲ Several methods to start recording: schedule /immediately start/key start/repeat start
- ▲ Recording function must be powered by adaptor
- ▲ Monitoring mode is powered by
  - battery or DC adaptor(8808)
  - adaptor (8809)
- ▲ Built in USB interface  
For program & down load
- ▲ LED flash& audible warning while exceeding threshold
- ▲ Up to 16000 points memories
- ▲ Temperature units switchable
- ▲ Salt bottle self-calibration available
- ▲ 8808 features: LCD display/date & time display
- ▲ 8809 features: red LED display

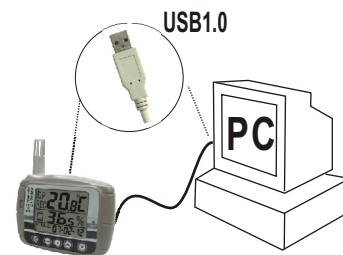

### Optional



**CAL. SALT BOTTLE**  
 P/N:VZ0033AZ1(33%)  
 P/N:VZ0075AZ1(75%)  
 FOR 8808, 8809  
 CALIBRATION USE

Model	8808	8809
Air temp. range	-20~70°C	
Air temp. resolution	0.1°C/°F	
Air temp. accuracy	+/-0.6°C (0~50°C), others +/-1.2°C	
Humidity. range	0%RH~100%RH	
Humidity resolution	0.1%RH	
Humidity accuracy	+/-3%RH (at 25°C, 10~90%RH, others +/-5%RH)	
Sampling points	16000	16000
Button to on/off	YES	YES
USB Interface	YES	YES
LCD size (mm)	51(H)x63(W)	
Storage temp.	-20~50°C	
Storage RH%	Humidity < 90%	
Dimension(mm)	120x93x42	120x93x42
Weight	~200g	~210g
Battery	AA bat.x4pcs or 9VDC adaptor	9VDC adaptor
Standard Package	Meter/Batteries(8808)or adaptor (8809) /Manual /Paper box/software CD/USB cable	
Optional Accessory	RH calibration salt kit	