
## **DIGITAL HEIGHT GAGE**



## scriber(included)




## supplied with a dust cover (except 1150-1500/2000)



data output cable




dial test indicator holder (included)

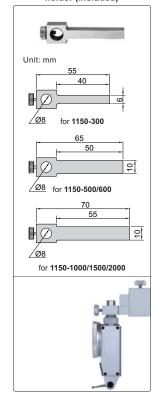



- Buttons: on/off, zero, mm/inch, ABS/INC, data hold, TOL, set
- ABS/INC is for absolute and incremental measurement
- TOL is for tolerance measurement
- Carbide tipped scriber
- Made of stainless steel (except the base)
- LR44 battery
- Data output
- Supplied with dial test indicator holder
- Supplied with a dust cover (except 1150-1500/2000)
- Optional accessory: data output cable (code **7301-SPC5**)

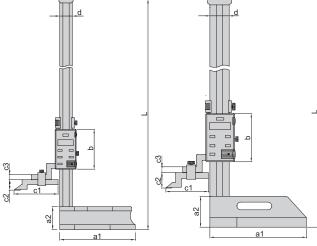

type A type B

Code	Range	Туре	Accuracy	L	a1	a2	b	c1	c2	c3	d	е	f
1150-300	0-300mm/0-12"	А	±0.04mm	470	135	45	80	76	25	10	23	6	8
1150-500	0-500mm/0-20"	А	±0.05mm	720	180	55	95	103	25	12	30	10	12
1150-600	0-600mm/0-24"	А	±0.05mm	820	180	55	95	103	25	12	30	10	12
1150-1000	0-1000mm/0-40"	В	±0.07mm	1275	250	80	125	110	39	15	50	10	15
1150-1500	0-1500mm/0-60"	В	±0.11mm	1790	280	80	125	110	39	15	50	10	15
1150-2000	0-2000mm/0-80"	В	±0.15mm	2290	280	80	125	110	39	15	50	10	15